UniTrans® Universal Transmitter for various applications Model UT-10 and UT-11

WIKA Data Sheet PE 86.01

Applications

- Process engineering
- Chemical engineering
- Plant construction
- Mechanical engineering

Special Features

- Scaleable measuring ranges via Turn down of up to 1:20
- Measuring range from 0 ... 5 mbar up to 0 ... 4,000 bar
- High measuring accuracy
- Fully welded, stainless steel diaphragm
- Multifunctional display



Fig. left Universal Transmitter UT-11 Fig. right Universal Transmitter UT-10

Description

Turn Down

With its maximal 1: 20 Turn Down ratio the UniTrans can be used in many different applications. This turndown ratio eliminates the necessity of keeping several transmitters in stock; it is much easier to turn down the transmitter instead of changing transmitters (e.g. a 100 bar transmitter can be turned down to 5 bar).

High measuring accuracy

The internal, digital signal processing allows for high measuring accuracy at fast measuring rates and pressure ranges from 5 mbar to 4,000 bar.

Multifunctional display

The optional display can be adjusted mechanically and electronically, thus guaranteeing many display variations and an optimal reading from different directions. Bargraph and trend are permanently displayed.

Only a minor modification of the case is required in order to be able to read the display from above. All standard units can be displayed. Two further lines are available for entering additional text (e.g. min./max. values or temperature at the sensor).

With the easy-to-use menu, the user can set parameters such as language, unit, zero poin, span or inverted signal.

The UniTrans also offers the possibility of a tank linearisation with up to 32 holding points.

Signal

The UniTrans is fed with an input power of 12 ... 36 DC V. The output signal is 4 ... 20 mA, 2-wire system. The user can program an inverted signal 20 ... 4 mA or damping (up to 40 seconds).

WIKA Data Sheet PE 86.01 · 06/2006


Page 1 of 4



Specifications		Model	odel UT-10, standard version / UT-11 flush diaphragm								
Pressure ranges 1) *)	bar	0.4	1.6	6	16	40	100	250	600	1	
Over pressure safety	bar	2	10	35	80	80	200	500	1200		
Burst pressure	bar	2.4	12	42	96	400	800	1200	2400 ³⁾		
Pressure ranges 1) *)		1000 ²⁾	1600 ²⁾	2500 ²⁾	4000 ²⁾						
Over pressure safety		1500	2000	3000	4400						
Burst pressure		3000	4000	5000	7000						
	{Vacuum, ga	auge pressi	ure, comp	ound rang	ge, absolu	ite press	ure are av	/ailable}	'	•	
	1) Other measuring ranges (e. g. 4 bar) can be set via the respective Turn down. Even when the measuring rang										
	is present by us on (e. g. 4 bar) the standard range of (6 bar) can be set again by a reset.										
	²⁾ Only Model UT-10.										
	³⁾ For model UT-11: the value specified in the table applies only when sealing is realised										
	with the sealing ring underneath the hex. Otherwise max. 1500 bar applies.										
Materials											
■ Wetted parts		(other m	(other materials see WIKA diaphragm seal program)								
➤ Model UT-10		Stainles	Stainless steel (pressure ranges > 25 bar additional Elgiloy®)								
➤ Model UT-11		Stainless steel {Hastelloy C4}; O-ring: NBR 4) {FPM/FKM or EPDM}									
■ Case		Highly resistive, fibreglass-enforced plastic (PBT); {Aluminum}									
Internal transmission fluid 5)		Synthetic oil {Halocarbon oil for oxygen applications}									
		{Listed by FDA for Food & Beverage}									
	4) O-ring made of FPM/FKM {EPDM} for Model UT-11 with integrated cooling element.										
	5) Not for UT-10 with pressure ranges > 25 bar										
Power supply U _B	DC V	12 < U _B									
Signal output and		_	4 20 mA, 2-wire								
maximum load R _A		$R_A \le (U_B - 12 \text{ V}) / 0.023 \text{ A with } R_A \text{ in Ohm and } U_B \text{ in Volt}$									
Adjustability		7. (-2	, , ,		. ,						
■ Zero Point	%	-2.5 9	9								
■ Span		Turn down of 1 : 20 (1 : 2 for pressure ranges > 1000 bar)									
Internal measuring rate	Hz	100									
Accuracy 6)	% of span										
		including non-linearity, hysteresis, non-repeatability, zero point and full scale error (corresponds to error of									
									re connection		
Behavior with Turn down (1 : k)											
■ Turn down of up to 1:5		No change of accuracy									
■ Turn down of 1 : 5 to 1 : 20			The accuracy must be multiplied by the factor (k / 5)								
			[Calculation example for TD = 1 : 15] Accuracy = $0.1 \times (15 : 5) = 0.3$								
Non-linearity	% of span	≤ 0.05 (≤ 0.2 for pressure ranges > 1000 bar) (BFSL) according to IEC 61298-2									
1-year stability	% of span	≤ 0.1 (at reference conditions)									
Overall deviation	%	at +10 +40 °C (+50 +104 °F): ≤ 0.15 (≤ 0.5 for pressure ranges > 1000 ba									
Permissible temperature of				,				•	J		
■ Medium *)		-30 +	105 °C (0	3 1 ½ up 1	to 30 min	140°C a	an ambie	ent tempe	rature of <	50 °C)	
			-30 +105 °C (G 1 ½ up to 30 min 140°C at an ambient temperature of < 50 °C) -30 +150 °C (G 1 according to EHEDG with cooling element)								
■ Ambience			,		with displ				158 °F with	display	
■ Storage		-40 +85 °C (-35+80 °C with display) -40 +185 °F (-31+176°F with display									
Compensated temp. range		-20 +80 °C -4 +176 °F									
Temperature coefficients within		(the temperature related deviations in the range +10 +40 °C / +50 +104 °F									
compensated temp range		included in the overall deviation)									
■ Mean TC of zero	% of span	≤ 0.1/ 10 K									
■ Mean TC of range	% of span	≤ 0.1 / 10 K									
Damping (display and signal)	s	0 40 (adjustable)									
CE- conformitiy		89/336/EWG interference emission and immunity see EN 61 326									
-			97/23/EG Pressure equipment directive (Module H)								
Shock resistance	g		ording to				ical shock	()			
Vibration resistance	g		ding to IE		,		under re	•			
Wiring protection	3								ige) on the		
							9 4114		J-, J		
Willing proteotion		instrume	U								

In an oxygen version model UT-11 is not available. In an oxygen version model UT-10 is only available in gauge pressure ranges from 0.4 bar up to max. 1000 bar and with media temperatures between -20 ... +60 °C / -4 ... +140 °F.
 Items in curved brackets are optional extras for additional price.

Dimensions in mm

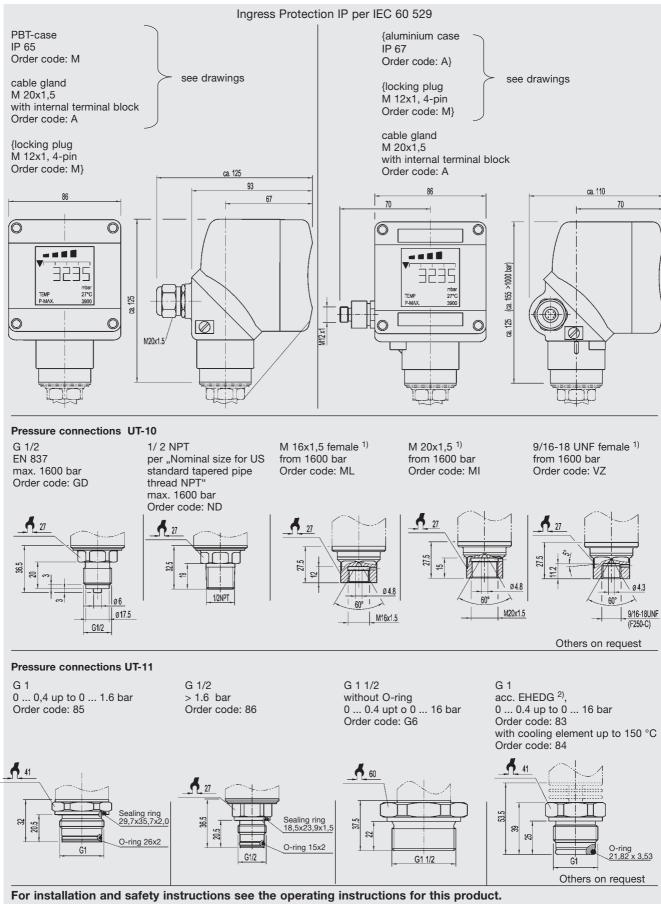


For installation and safety instructions see the operating instructions for this product.


For tapped holes and welding sockets please see Technical Information IN 00.14 for download at www.wika.de -Service

- 1) The respective values for your mounting position please find in the documentation of your high-pressure equipment supplier.
- 2) European Hygienic Equipment Design Group
- {} Items in curved brackets are optional extras for additional price.

Electrical Connection

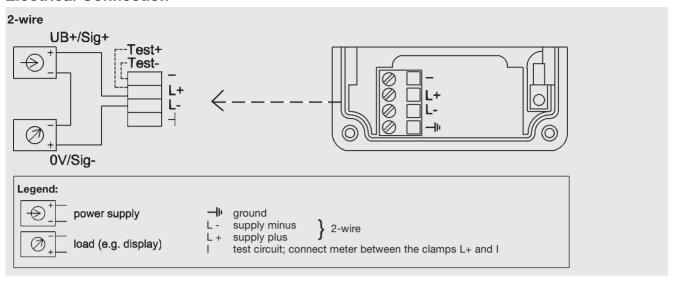

Random example of the optional display

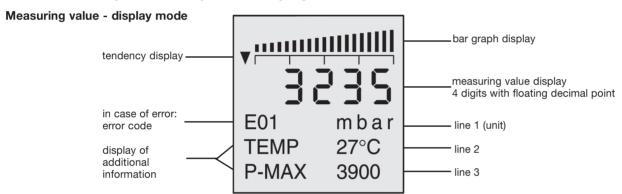

Further information

You can obtain further information (data sheets, instructions, etc.) via



Specifications and dimensions given in this leaflet represent the state of engineering at the time of printing. Modifications may take place and materials specified may be replaced by others without prior notice.

